


Technical SUPPORT

Changelog for LFX Master DMX to firmware version > 2

further support www.movie-inter.com
send an **eMail** or give us a call.


NEW set-up procedure with firmware 2.0

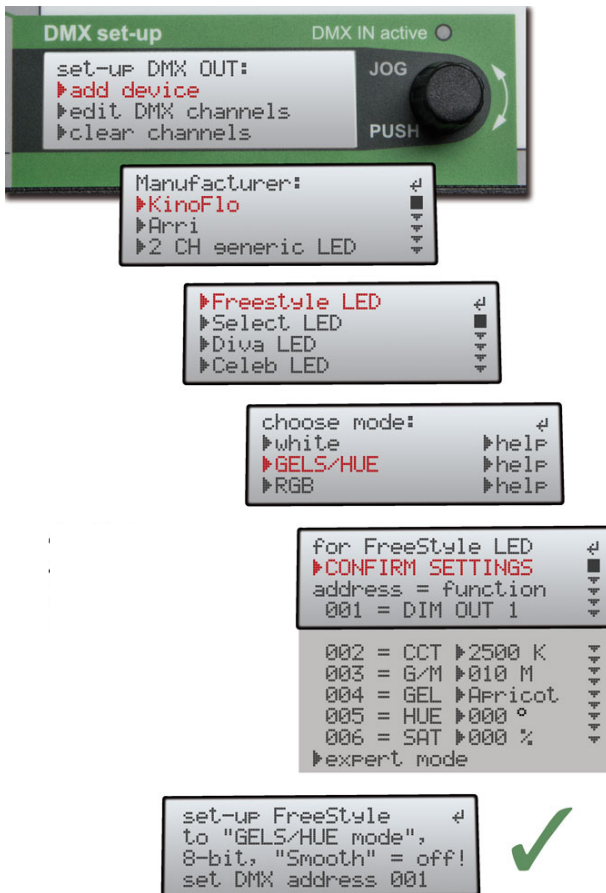

This firmware upgrade vastly improves lighting effect experience.

Enter the fixture settings instead of DMX values!

This significantly simplifies the set-up of LED fixtures.

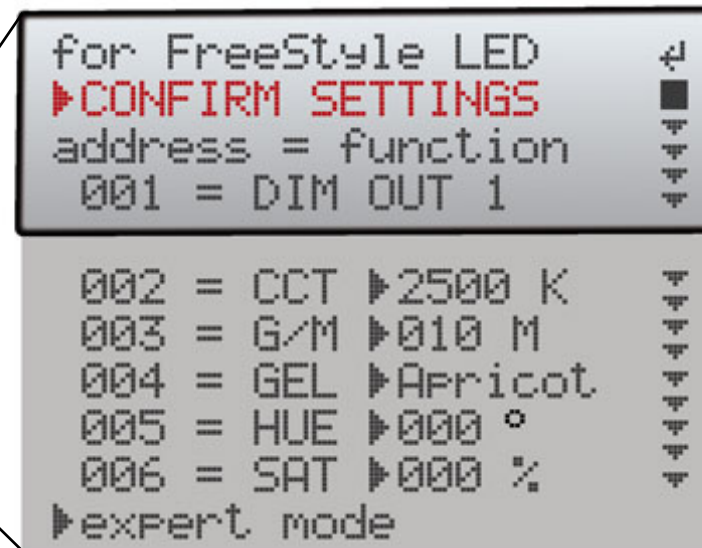

Release date:
June 2018

This software update is available for FREE.

Please contact us by e-mail to get this firmware.

See full list of new features and improvements on the next page.

Technical SUPPORT

Changelog of firmware update 2.0 for LFX Master DMX



phone +49 (0)30-2232 0575
fax +49 (0)30-2232 0571
web www.movie-inter.com
mail info@movie-inter.com

- NEW: all DMX OUT device presets for ARRI and Kino Flo show now parameters in Kelvin, Green/Magenta, hue & saturation as instantly adjustable values instead of DMX numbers (see example on page 1)
- NEW: Values of the parameters as shown above are also now also visible/editable in the DMX OUT "expert mode" instead of DMX numbers.
- NEW: DMX OUT device presets for ARRI and Kino Flo now contain its according GEL library by gel names selectable in an alphabetical sorted list instead of showing its DMX values only. It means it's not necessary any further to know a DMX value of a gel.
- NEW: Added possibility in DMX IN expert mode to add a trigger function for full remote control of the flicker box by DMX.
If DMX value is 0...5% = all DIM Output channels are disabled, > 5% = enabled
- NEW: Added possibility to set-up a DMX start address for DMX IN presets "3x OUT separate DIM" and "full remote control" > all required following DMX channels are automatically changed
- IMPROVED: Maximum speed of Strobe effect increased from 12.6 Hz to 14.2 Hz
- IMPROVED: DMX OUT preset "RGBW" for Arri's Skypanel has now optimised settings
- IMPROVED: Due to ARRI's firmware update of the Skypanel its according device presets for Gel Mode are now optimised.

Technical SUPPORT

Changelog of firmware update 2.0 for LFX Master DMX



phone +49 (0)30-2232 0575
fax +49 (0)30-2232 0571
web www.movie-inter.com
mail info@movie-inter.com

- CHANGED: In DMX IN preset "full remote control": channels for "Effect" and "Speed" are now swapped.
- BUGFIX: In DMX OUT a DMX value is now set to 000 if a DMX OUT channel is "deleted".
- BUGFIX: In case there is a dimmer console connected at DMX IN during a DMX OUT set-up procedure there is no more flicker of a connected LED fixture before settings are confirmed.

Detailed upgrade guide

Please find on www.movie-inter.com > flicker boxes > LFX Master DMX > downloads a step-by-step firmware upgrade guide. The upgrade process takes just one minute.

required equipment for the upgrade: Torx TX10 screwdriver, micro SD-card (max. 32 GB), firmware

New user manual

Please download the revised user manual for detailed information of all features.

This is a public beta firmware.

If you figure out any issues please do not hesitate to let us know!

Thank you.